





Installation parameters: drilling hole, cleaning and installation

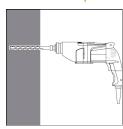

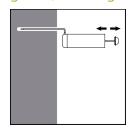

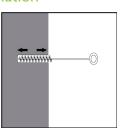

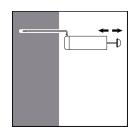

Drill hole in the substrate to the required embedment depth using the appropriate size drill bit.

Clean the hole. Before setting an anchor, the drilled hole must be free of dust and debris.

A blow out pump must be used for blowing out drilled holes up to diameters ≤ 24mm and embedment depths up to 10 x drilled hole diameters.


Blow out at least 4 times from the back of the drilled hole, using an extension if needed.


Brush 4 times with the specified brush size by inserting the steel brush to the back of the hole (if needed with an extension) in a twisting motion and remove the debris.

Blow out again with pump at least 4 times.

Cleaning with compressed air is suitable for all bore hole diameters and depths




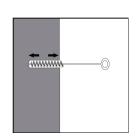


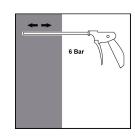


Blow twice from the back of the hole (if needed with a nozzle extension) over the whole length with oil-free compressed air (min. 6 bar at 6 m³/h). Brush twice with the specified brush size (see Table 6) by inserting the steel brush to the back of the hole (if required with an extension) in a twisting motion and remove the debris.

Blow out again with compressed air at least twice.

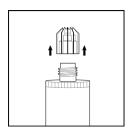

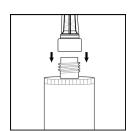



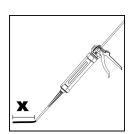



Remove the threaded cap from the cartridge.


Tightly attach the mixing nozzle.

Do not modify the mixer in any way. Make sure the mixing element is inside the mixer.

Use only the supplied mixer. Insert the cartridge into the dispenser gun. Discard the initial trigger pulls (10ml) of resin.

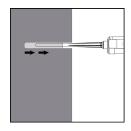

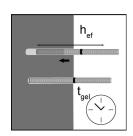

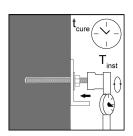

Inject the adhesive starting at the back of the hole, slowly withdrawing the mixer with each trigger pull.

Fill holes approximately 2/3 full, to ensure that the annular gap between the anchor and the concrete is completely filled with resin along the embedment depth.

Before use, verify that the threaded rod is dry and free of contaminants. Install the threaded rod to the required embedment depth before the gel working time has elapsed.

The working time is shown in 'Minimum Curing Time' table on page 12. The anchor can be loaded after the required curing time (see page 12). The applied torque shall not exceed the maximum value given in the table on page 2.